

Service Request: 424949 **Requester**: Ken Vu

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:Created at: May 01, 2017 11:30AMCreated by: josev

Request: Red Flex says they had a knock-down and now they have no power. Please check and advise.

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$35.77

Task #1

Status: CLOSED on May 01, 2017 02:07PM by Jose Vasquez

Description: No task description

Comments: I found that Red Flex gets power for there equipment from our traffic signal electrical service. I found that the circuit breaker for there equipment was tripped and it was installed in the ISNS slot (wrong location). I rearranged the circuit breakers and reset their circuit. I called Ken and informed him of what I found.

Category: 800 MISC. Assigned to: Jose Vasquez
Division: ENGR SERVICES Requester contacted:

Completed by: Jose Vasquez **ECD:**

Total task cost: \$35.775

Actions: 800.2 OTHER (SEE COMMENTS)

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 0.5 hours | 0 hours | \$35.77 |
| TOTAL | 0.5 hours | 0 hours | \$35.77 |



Service Request: 423772 Requester: Jose Vasquez

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:Created at: April 05, 2017 01:15PMCreated by: josev

Request: 2 EB Frwy underpass wall pack lights are out on the south side of Trask. It's the second and forth

light heading EB.

Location: HARBOR BLVD / TRASK AVE, EB / WB frwy underpass

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$71.55

Task #1

Status: CLOSED on April 05, 2017 02:45PM by Jose Vasquez

Description: No task description

Comments: Replaced 2 lamps and 1 ballast.

Category: 710 ST. LIGHTS/ILLUM. NAME SIGNS Assigned to: Jose Vasquez Division: ENGR SERVICES Requester contacted:

Completed by: Jose Vasquez **ECD:**

Total task cost: \$71.55

Actions: 710.1 REPLACED LAMP, 710.5 REPLACED BALLAST

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 1.0 hours | 0 hours | \$71.55 |
| TOTAL | 1.0 hours | 0 hours | \$71.55 |



Service Request: 422974 Requester: Jose Vasquez

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:Created at: March 07, 2017 12:30PMCreated by: josev

Request: Replace all remaining GE count-down ped modules. Assigned to Yanie (Siemens contractor).

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$71.55

Task #1

Status: CLOSED on March 07, 2017 01:30PM by Jose Vasquez

Description: No task description

Comments: Yanie replaced 4 remaining GE ped modules with new Dialite count-down ped modules.

Category: 700 SIGNAL MAINTENANCE

Division: ENGR SERVICES

Assigned to: Jose Vasquez

Requester contacted:

Completed by: Jose Vasquez **ECD:**

Total task cost: \$71.55

Actions: 700.15 REPLACED PEDESTRIAN MODULE

| Name | Reg | ОТ | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 1.0 hours | 0 hours | \$71.55 |
| TOTAL | 1.0 hours | 0 hours | \$71.55 |



Service Request: 422101 Requester: PD Dispatch

Department: PoliceHome Phone:Status: CLOSEDWork Phone:Priority: EMERGENCYOther Phone:Created at: March 03, 2017 03:50PMCreated by: josev

Request: Intersection is in 4-way red flash.

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$194.82 **File attachments**: 3

Task #1

Status: CLOSED on March 03, 2017 05:15PM by Jose Vasquez

Description: No task description

Comments: Arrived at 4:20pm and found the intersection in flash. MMU indicated a conflict with phase 6 ped. I found a shorted phase 6 ped module on the SWC. I removed and discarded the old GE count down ped module and installed a new Dialite count down ped module. I reset the MMU and the intersection was operational by 4:38pm. I went ahead and removed the old phase 6 ped module on the SEC and installed a new Dialite count down ped as preventive maintenance.

Category: 700 SIGNAL MAINTENANCE

Division: ENGR SERVICES

Assigned to: Jose Vasquez


Requester contacted:

Completed by: Jose Vasquez ECD:

Total task cost: \$194.82

Actions: 700.15 REPLACED PEDESTRIAN MODULE

| Name | Reg | ОТ | Total |
|--------------|---------|-----------|----------|
| Jose Vasquez | 0 hours | 3.0 hours | \$194.82 |
| TOTAL | 0 hours | 3.0 hours | \$194.82 |

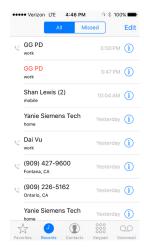

Photos for Workorder #422101







Service Request: 421552 Requester: Jose Vasquez

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: February 22, 2017 11:30AM Created by: howardb

Request: Disconnect the old fire-station preemption push-button signal wire calling the controller. Leave the

Caltrans signal intact. Also remove the Delay and Duration times for preempt 3 in the controller.

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$35.77

Task #1

Status: CLOSED on February 22, 2017 12:00PM by Howard Brown

Description: No task description

Comments: Removed and taped off the wire on our side of the Test panel in the controller, leaving the Caltrans side intact. I removed 33 seconds of preempt call delay and 45 seconds of preempt duration for

preempt 3. Everything is working as designed with the new Opticom EVP detectors.

Category: 700 SIGNAL MAINTENANCE

Assigned to: Jose Vasquez

Division: ENGR SERVICES Requester contacted:

Completed by: Jose Vasquez **ECD**:

Total task cost: \$35.775

Actions: 700.26 OTHER (SEE COMMENTS)

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 0.5 hours | 0 hours | \$35.77 |
| TOTAL | 0.5 hours | 0 hours | \$35.77 |



Service Request: 421438 Requester: Jose Vasquez

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:Created at: February 14, 2017 10:32AMCreated by: josev

Request: PREVENTIVE MAINTENANCE. Assigned to Siemens contractor Yanie.

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$71.55

Task #1

Status: CLOSED on February 14, 2017 11:32AM by Jose Vasquez

Description: No task description

Comments: Yanie, VACUUMED CONTROLLER CABINET-REPLACED AIR FILTER-PERFORMED P.M. SCHEDULE-WALKED INTERSECTION-REMOVED GRAFFITI FROM CONTROLLER CABINET

AND POLES.

Category: 700 SIGNAL MAINTENANCE

Division: ENGR SERVICES

Assigned to: Jose Vasquez

Requester contacted:

Completed by: Jose Vasquez **ECD:**

Total task cost: \$71.55

Actions: 700.26 OTHER (SEE COMMENTS), 740.1 GRAFFITI REMOVED/COVERED

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 1.0 hours | 0 hours | \$71.55 |
| TOTAL | 1.0 hours | 0 hours | \$71.55 |



Service Request: 419995 Requester: Jose Vasquez

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:Created at: January 19, 2017 11:00AMCreated by: josev

Request: 2 wall pack lights on the east-side and 1 on the west-side freeway underpass is out. Assigned to

Siemens contractor Yanie.

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$67.90

Task #1

Status: CLOSED on January 19, 2017 12:00PM by Jose Vasquez

Description: No task description

Comments: Replaced 3 lamps. Everything is now working as designed. **Category**: 700 SIGNAL MAINTENANCE **Assigned to**:

Division: ENGR SERVICES **Requester contacted:**

Completed by: Jose Vasquez **ECD:**

Total task cost: \$67.9

Actions: 710.1 REPLACED LAMP

| Name | Reg | ОТ | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 1.0 hours | 0 hours | \$67.90 |
| TOTAL | 1.0 hours | 0 hours | \$67.90 |



ECD:

Service Request: 417838 Requester: Howard Brown

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: November 30, 2016 01:00PM Created by: howardb

Request: NORTHBOUND TO WESTBOUND 10 FT RED ARROW IS OUT

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$82.83

Task #1

Status: CLOSED on November 30, 2016 10:00AM by Howard Brown

Description: REPLACED BURNED OUT LED

Category: 700 SIGNAL MAINTENANCE Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted**:

Completed by: Howard Brown

Total task cost: \$82.83

Actions: 700.1 REPLACED LAMP

| Name | Reg | ОТ | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 1.0 hours | 0 hours | \$82.83 |
| TOTAL | 1.0 hours | 0 hours | \$82.83 |



ECD:

Service Request: 415051 Requester: JOSE VASQUEZ

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: October 06, 2016 11:27AM Created by: howardb

Request: 2 WALL PACK LIGHT ARE OUT- UNDER PASS WEST OF HARBOR

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$75.37

Task #1

Status: CLOSED on October 04, 2016 10:30AM by Howard Brown

Description: REPLACED BOTH LAMPS 150 WATT HPS

Category: 710 ST. LIGHTS/ILLUM. NAME SIGNS Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted:**

Completed by: Howard Brown

Total task cost: \$75.365

Actions: 710.1 REPLACED LAMP

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 0.5 hours | 0 hours | \$41.41 |
| Jose Vasquez | 0.5 hours | 0 hours | \$33.95 |
| TOTAL | 1.0 hours | 0 hours | \$75.37 |



Service Request: 413471 Requester: Jose Vasquez

Department: Public Works

Status: CLOSED

Work Phone:

Other Phone:

Created at: August 31, 2016 08:30AM

Home Phone:

Other Phone:

Created by: josev

Request: PREVENTIVE MAINTENANCE.

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$101.85

Task #1

Status: CLOSED on August 31, 2016 10:00AM by Jose Vasquez

Description: No task description

Comments: VACUUMED CONTROLLER CABINET-REPLACED AIR FILTER-PERFORMED P.M. SCHEDULE-WALKED INTERSECTION-REMOVED GRAFFITI FROM CONTROLLER CABINET AND

POLES.

Category: 700 SIGNAL MAINTENANCE

Division: ENGR SERVICES

Assigned to: Jose Vasquez

Requester contacted:

Completed by: Jose Vasquez **ECD:**

Total task cost: \$101.85

Actions: 700.26 OTHER (SEE COMMENTS), 740.1 GRAFFITI REMOVED/COVERED

| Name | Reg | OT | Total |
|--------------|-----------|---------|----------|
| Jose Vasquez | 1.5 hours | 0 hours | \$101.85 |
| TOTAL | 1.5 hours | 0 hours | \$101.85 |



Service Request: 412615 Requester: Howard Brown

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:Created at: August 11, 2016 09:00AMCreated by: josev

Request: Phase 8 ped is recalling.

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$54.32 **File attachments**: 1

Task #1

Status: CLOSED on August 11, 2016 09:45AM by Jose Vasquez

Description: No task description

Comments: Found ped station on the SEC hanging by the damaged wires. Looked as if a vehicle knocked the

station off of the pole. Replaced damaged wire and broken ped station bolts. Reinstalled ped station.

Category: 700 SIGNAL MAINTENANCE

Division: ENGR SERVICES

Assigned to: Jose Vasquez

Requester contacted:

Completed by: Jose Vasquez **ECD:**

Total task cost: \$54.32

Actions: 700.14 REPLACED PED P/BUTTON ASSEMBLY, 700.26 OTHER (SEE COMMENTS)

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 0.8 hours | 0 hours | \$54.32 |
| TOTAL | 0.8 hours | 0 hours | \$54.32 |

Photos for Workorder #412615





Service Request: 410431 Requester: Howard Brown

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: June 30, 2016 07:41AM Created by: howardb

Request: MALFUNCTION MANAGEMENT UNIT CHECK

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$23.91

Task #1

Status: CLOSED on June 30, 2016 05:30AM by Howard Brown

Description: INSTALLED TESTED ECONOLITE MALFUNCTION MANAGEMENT UNIT # 081107905

Category: 700 SIGNAL MAINTENANCE Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted:**

Completed by: Howard Brown ECD:

Total task cost: \$23.907

Actions: 700.20 OTHER - SEE COMMENTS

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 0.3 hours | 0 hours | \$23.91 |
| TOTAL | 0.3 hours | 0 hours | \$23.91 |



ECD:

Service Request: 408069 Requester: Howard Brown

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: May 16, 2016 07:12AM Created by: howardb

Request: GREEN ARROW OUT FOR RIGHT TURN NORTHEAST CORNER

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$79.69

Task #1

Status: CLOSED on May 03, 2016 02:00PM by Howard Brown

Description: REPLACED BURNED OUT LED

Category: 700 SIGNAL MAINTENANCE Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted**:

Completed by: Howard Brown

Total task cost: \$79.69

Actions: 700.1 REPLACED LAMP

| Name | Reg | ОТ | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 1.0 hours | 0 hours | \$79.69 |
| TOTAL | 1.0 hours | 0 hours | \$79.69 |



Service Request: 407577 Requester: Jose Vasquez

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:Created at: May 04, 2016 08:32AMCreated by: josev

Request: PREVENTIVE MAINTENANCE.

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$98.00

Task #1

Status: CLOSED on May 04, 2016 10:00AM by Jose Vasquez

Description: No task description

Comments: While walking the intersection I noticed that the ped-push-button on the SEC (phase8) was not working and the ped-push-button on the NWC (phase 4) was vandalized and not working either. On the SEC button I found that the common conductor screw had come off of the terminal. I reinstalled the conductor and screw and tested the button. I replaced the button on the NWC with a new ADA button and tested the button. Everything is now working as designed. VACUUMED CONTROLLER CABINET-REPLACED AIR FILTER-

PERFORMED P.M. SCHEDULE-WALKED INTERSECTION-REMOVED GRAFFITI FROM

CONTROLLER CABINET AND POLES.

Category: 700 SIGNAL MAINTENANCE

Division: ENGR SERVICES

Assigned to: Jose Vasquez

Requester contacted:

Completed by: Jose Vasquez **ECD**:

Total task cost: \$97.995

Actions: 700.14 REPLACED PED P/BUTTON ASSEMBLY, 700.26 OTHER (SEE COMMENTS), 740.1

GRAFFITI REMOVED/COVERED

| Name | Reg | ОТ | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 1.5 hours | 0 hours | \$98.00 |
| TOTAL | 1.5 hours | 0 hours | \$98.00 |



Service Request: 403201 Requester: Howard Brown

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: February 04, 2016 02:45PM Created by: howardb

Request: 2 WALL PACK LIGHTS OUT EASTSIDE -HARBOR UNDERPASS

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$119.53

Task #1

Status: CLOSED on February 04, 2016 11:30AM by Howard Brown

Description: FOUND MISSING PULL BOX LID AND CONDUCTOR CUT/RE-SPLICED CONDUCTOR

TO RESTORE POWER-OK ALSO REPLACED MISSING PULL BOX LID- CHRISTY #30

Category: 710 ST. LIGHTS/ILLUM. NAME SIGNS Assigned to: Howard Brown

Division: ENGR SERVICES Requester contacted:

Completed by: Howard Brown **ECD**:

Total task cost: \$119.535

Actions: 710.6 REPAIRED WIRES

| Name | Reg | OT | Total |
|--------------|-----------|---------|----------|
| Howard Brown | 1.5 hours | 0 hours | \$119.53 |
| TOTAL | 1.5 hours | 0 hours | \$119.53 |



Service Request: 403200 Requester: JIM TUCKER

Department: PoliceHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: February 04, 2016 02:42PM Created by: howardb

Request: MEET WITH JIM TUCKER

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$79.69

Task #1

Status: CLOSED on February 04, 2016 10:00AM by Howard Brown

Description: MET WITH JIM AND JIM'S REPLACEMENT TO REVIEW OPERATION OF TRAFFIC

SIGNAL

Category: 700 SIGNAL MAINTENANCE Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted:**

Completed by: Howard Brown **ECD**:

Total task cost: \$79.69

Actions: 700.20 OTHER - SEE COMMENTS

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 1.0 hours | 0 hours | \$79.69 |
| TOTAL | 1.0 hours | 0 hours | \$79.69 |



Service Request: 403077 Requester: Howard Brown

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: January 30, 2016 06:06AM Created by: howardb

Request: UNDERPASS LIGHTS OUT

Location: HARBOR BLVD / TRASK AVE, TRASK UNDERPASS LIGHTS FIRST & FIFTH LIGHTS

GOING EASTBOUND

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$43.51

Task #1

Status: CLOSED on January 29, 2016 01:45PM by Howard Brown

Description: REPLACED 2 150 WATT LAMPS

Category: 710 ST. LIGHTS/ILLUM. NAME SIGNS Assigned to: Howard Brown

Division: ENGR SERVICES Requester contacted:

Completed by: Howard Brown **ECD**:

Total task cost: \$43.506

Actions: 710.1 REPLACED LAMP

| Name | Reg | ОТ | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 0.3 hours | 0 hours | \$23.91 |
| Jose Vasquez | 0.3 hours | 0 hours | \$19.60 |
| TOTAL | 0.6 hours | 0 hours | \$43.51 |



ECD:

Service Request: 403014 Requester: Howard Brown

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: January 30, 2016 06:15AM Created by: howardb

Request: HARBOR UNDERPASS 2 WALL PACK LIGHTS ARE OUT

Location: HARBOR BLVD / TRASK AVE, HARBOR UNDERPASS NORTHBOUND

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$72.51

Task #1

Status: CLOSED on January 29, 2016 08:00AM by Howard Brown

Description: REPLACED THE FIRST 2 LAMPS GOING NORTHBOUND

Category: 710 ST. LIGHTS/ILLUM. NAME SIGNS Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted:**

Completed by: Howard Brown

Completed by. Howard Brown

Total task cost: \$72.51

Actions: 710.1 REPLACED LAMP

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 0.5 hours | 0 hours | \$32.66 |
| Howard Brown | 0.5 hours | 0 hours | \$39.84 |
| TOTAL | 1.0 hours | 0 hours | \$72.51 |



Service Request: 402856 Requester: JIM TUCKER

Department: PoliceHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: January 28, 2016 08:24AM Created by: howardb

Request: SHOW INTERIOR OF CONTROLLER CABINET TO POLICE

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$79.69

Task #1

Status: CLOSED on January 20, 2016 12:00PM by Howard Brown

Description: SHOWED INTERIOR OF CABINET AND GAVE THE OFFICER A BRIEF DESCRIPTION

OF HOW THE INTERSECTION OPERATES

Category: 700 SIGNAL MAINTENANCE Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted**:

Completed by: Howard Brown **ECD**:

Total task cost: \$79.69

Actions: 700.20 OTHER - SEE COMMENTS

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 1.0 hours | 0 hours | \$79.69 |
| TOTAL | 1.0 hours | 0 hours | \$79.69 |



Service Request: 402104 Requester: Howard Brown

Department:Home Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: January 13, 2016 09:17AM Created by: howardb

Request: PEDESTRIAN PUSH BUTTON STATION DESTROYED ON THE SOUTHEAST CORNER FOR

NORTHBOUND

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$39.84

Task #1

Status: CLOSED on January 07, 2016 02:30PM by Howard Brown

Description: REPLACED PPB ASSEMBLY -CAP & MICROSWITCH AND RE-INSTALLED HAND

HOLE COVER

Category: 700 SIGNAL MAINTENANCE Assigned to: Howard Brown

Division: ENGR SERVICES Requester contacted:

Completed by: Howard Brown **ECD**:

Total task cost: \$39.845

Actions: 700.20 OTHER - SEE COMMENTS

| Name | Reg | ОТ | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 0.5 hours | 0 hours | \$39.84 |
| TOTAL | 0.5 hours | 0 hours | \$39.84 |



Service Request: 401034 Requester: Jose Vasquez

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:Created at: December 08, 2015 10:00AMCreated by: josev

Request: PREVENTIVE MAINTENANCE.

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$98.00

Task #1

Status: CLOSED on December 08, 2015 11:33AM by Jose Vasquez

Description: No task description

Comments: VACUUMED CONTROLLER CABINET-REPLACED AIR FILTER-PERFORMED P.M. SCHEDULE-WALKED INTERSECTION-REMOVED GRAFFITI FROM CONTROLLER CABINET AND

POLES.

Category: 700 SIGNAL MAINTENANCE

Division: ENGR SERVICES

Assigned to: Jose Vasquez

Requester contacted:

Completed by: Jose Vasquez **ECD:**

Total task cost: \$97.995

Actions: 700.26 OTHER (SEE COMMENTS), 740.1 GRAFFITI REMOVED/COVERED

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 1.5 hours | 0 hours | \$98.00 |
| TOTAL | 1.5 hours | 0 hours | \$98.00 |



Service Request: 399153 Requester: Howard Brown

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: October 27, 2015 11:53AM Created by: howardb

Request: 1 WALL PACK LIGHT OUT

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$79.69

Task #1

Status: CLOSED on October 23, 2015 08:00AM by Howard Brown

Description: REPLACED BAD LAMP ON THE TRASK UNDERPASS-THE FIRST LIGHT WESTBOUND

Category: 710 ST. LIGHTS/ILLUM. NAME SIGNS Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted:**

Completed by: Howard Brown ECD:

Total task cost: \$79.69

Actions: 710.1 REPLACED LAMP

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 1.0 hours | 0 hours | \$79.69 |
| TOTAL | 1.0 hours | 0 hours | \$79.69 |



ECD:

Service Request: 397494 Requester: DIG ALERT

Department:Home Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: September 22, 2015 07:19AM Created by: howardb

Request: MARK TRAFFIC SIGNAL & FIBER OPTIC UNDERGROUND UTILITIES

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$72.51

Task #1

Status: CLOSED on September 17, 2015 10:00AM by Howard Brown **Description**: MARKED NORTHEAST & SOUTHEAST CORNERS

Category: 700 SIGNAL MAINTENANCE Assigned to: Howard Brown

Division: ENGR SERVICES Requester contacted:

Completed by: Howard Brown

Total task cost: \$72.51

Actions: 700.20 OTHER - SEE COMMENTS

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 0.5 hours | 0 hours | \$39.84 |
| Jose Vasquez | 0.5 hours | 0 hours | \$32.66 |
| TOTAL | 1.0 hours | 0 hours | \$72.51 |



Service Request: 396527 Requester: CHARLES - ITERIS

Department:Home Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: August 28, 2015 06:29AM Created by: howardb

Request: CONDUIT CHECK

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$145.02

Task #1

Status: CLOSED on August 19, 2015 09:00AM by Howard Brown

Description: CONTRACTOR WANTED ASSISTANCE CHECKING INTERSECTION CONDUITS AND

LOCATING PULL BOXES

Category: 700 SIGNAL MAINTENANCE Assigned to: Howard Brown

Division: ENGR SERVICES Requester contacted:

Completed by: Howard Brown **ECD**:

Total task cost: \$145.02

Actions: 700.20 OTHER - SEE COMMENTS

| Name | Reg | ОТ | Total |
|--------------|-----------|---------|----------|
| Howard Brown | 1.0 hours | 0 hours | \$79.69 |
| Jose Vasquez | 1.0 hours | 0 hours | \$65.33 |
| TOTAL | 2.0 hours | 0 hours | \$145.02 |



Service Request: 396071 Requester: Jose Vasquez

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:Created at: August 19, 2015 08:30AMCreated by: josev

Request: PREVENTIVE MAINTENANCE.

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$98.00

Task #1

Status: CLOSED on August 19, 2015 10:30AM by Jose Vasquez

Description: No task description

Comments: VACUUMED CONTROLLER CABINET-REPLACED AIR FILTER-PERFORMED P.M. SCHEDULE-WALKED INTERSECTION-REMOVED GRAFFITI FROM CONTROLLER CABINET AND

POLES.

Category: 700 SIGNAL MAINTENANCE

Division: ENGR SERVICES

Assigned to: Jose Vasquez

Requester contacted:

Completed by: Jose Vasquez **ECD:**

Total task cost: \$97.995

Actions: 700.26 OTHER (SEE COMMENTS), 740.1 GRAFFITI REMOVED/COVERED

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Jose Vasquez | 1.5 hours | 0 hours | \$98.00 |
| TOTAL | 1.5 hours | 0 hours | \$98.00 |



Service Request: 396053 Requester: Howard Brown

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: August 19, 2015 07:17AM Created by: howardb

Request: HAND HOLE COVER MISSING SOUTHEAST CORNER

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$79.69

Task #1

Status: CLOSED on August 17, 2015 02:00PM by Howard Brown

Description: REPLACED LARGE RECTANGULAR HAND HOLE COVER AND ALSO REMOVED

GRAFFITI FROM THE CONTROLLER CABINET & POLES

Category: 700 SIGNAL MAINTENANCE Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted**:

Completed by: Howard Brown **ECD**:

Total task cost: \$79.69

Actions: 700.20 OTHER - SEE COMMENTS, 740.1 GRAFFITI REMOVED/COVERED

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 1.0 hours | 0 hours | \$79.69 |
| TOTAL | 1.0 hours | 0 hours | \$79.69 |



Service Request: 393989 Requester: Howard Brown

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: July 07, 2015 08:01AM Created by: howardb

Request: MALFUNCTION MANAGEMENT UNIT CHECK

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$15.94

Task #1

Status: CLOSED on July 07, 2015 06:30AM by Howard Brown

Description: INSTALLED TESTED ECONOLITE MALFUNCTION MANAGEMENT UNIT # 141201064

Category: 700 SIGNAL MAINTENANCE Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted:**

Completed by: Howard Brown ECD:

Total task cost: \$15.938

Actions: 700.20 OTHER - SEE COMMENTS

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 0.2 hours | 0 hours | \$15.94 |
| TOTAL | 0.2 hours | 0 hours | \$15.94 |



ECD:

Service Request: 391917 Requester: JOSE VASQUEZ

Department: Public WorksHome Phone:Status: CLOSEDWork Phone:Priority: NORMALOther Phone:

Created at: May 21, 2015 06:27AM Created by: howardb

Request: SAFETY LIGHT OUT SOUTHEAST CORNER

Location: HARBOR BLVD / TRASK AVE,

Public Property: NO Eng. Permit: Square Feet: Police Num.: Fire Num.:

Total cost: \$55.10

Task #1

Status: CLOSED on May 20, 2015 06:30AM by Howard Brown **Description**: REPLACED 200 WATT HIGH PRESSURE LAMP

Category: 710 ST. LIGHTS/ILLUM. NAME SIGNS Assigned to: Howard Brown

Division: ENGR SERVICES **Requester contacted:**

Completed by: Howard Brown

Total task cost: \$55.104

Actions: 710.1 REPLACED LAMP

| Name | Reg | OT | Total |
|--------------|-----------|---------|---------|
| Howard Brown | 0.7 hours | 0 hours | \$55.10 |
| TOTAL | 0.7 hours | 0 hours | \$55.10 |